

10027073, 11018097

EN Adding Zeolite fill tube shields

This document contains confidential information. Any unauthorized copy, disclosure or distribution is prohibited.

Affected Countries

USA, Canada

Affected Appliances

US built Bosch dishwashers with "Crystal Dry" zeolite drying built through FD 0301.
Dishwashers built FD 0302 or later are not affected.

Fault description / Customers complaint

Some fill tubes that deliver water to the middle and top rack can develop cracks, holes, or split seams over time. To prevent this deterioration, a cover shield was added starting FD 0302 to all zeolite models.

Parts required


Fill tube shield material #: 10027073

Repair actions

Perform fill tube shield preventative repair – install fill tube shield # 10027073 onto the fill tube whenever any unrelated repair is done on an affected unit.

Instructions

1. Open door and remove all racks. If needed for access, rotate or remove lower spray arm.
2. Align the fill tube shield over the fill tube with the wider open end toward the rear of the tub (1) and push it down to snap it into place onto the fill tube (2).

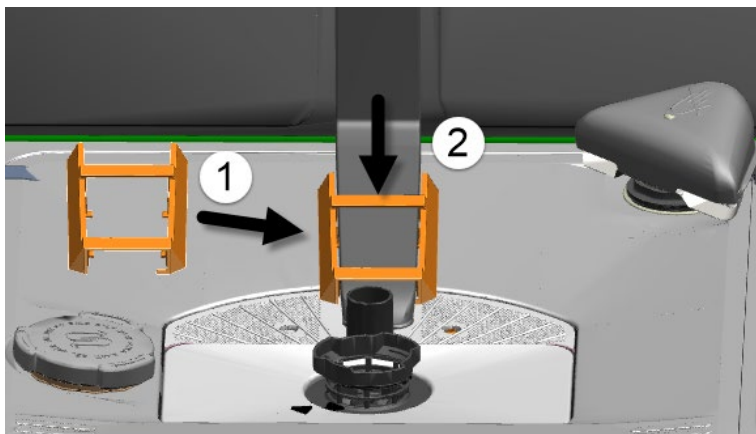

3. Install lower spray arm, if previously removed, and all racks.

This material is intended for the sole use of BSH authorized persons and may contain confidential and proprietary information. Any unauthorized review, use, copying, disclosure, or distribution in any format is prohibited.